

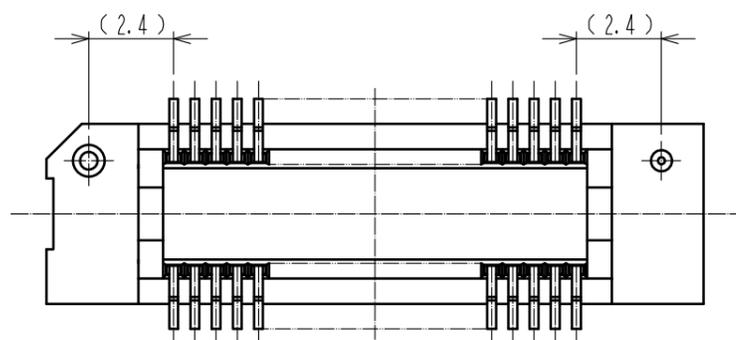
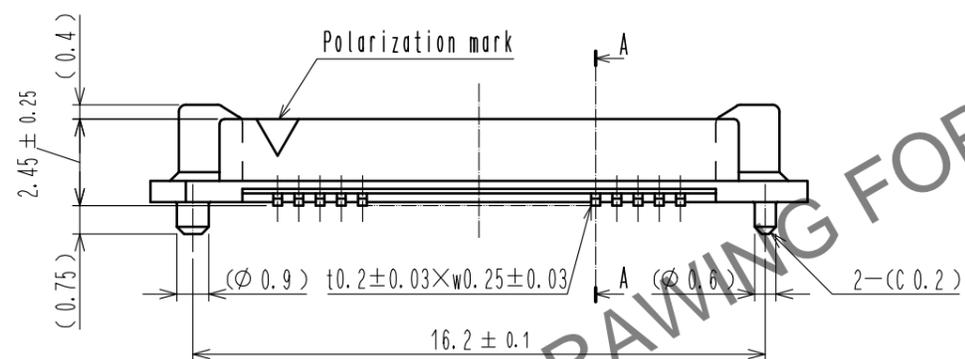
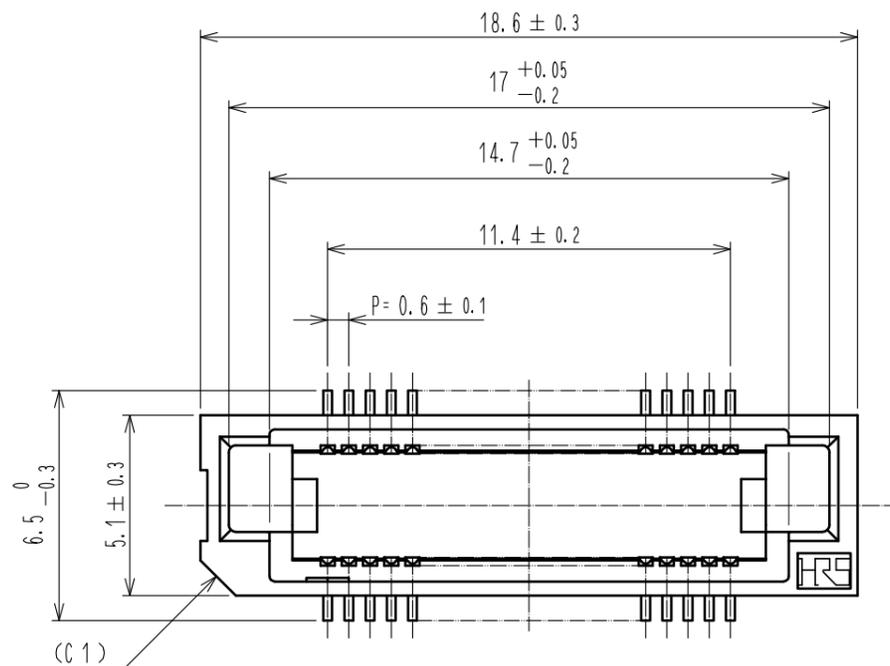
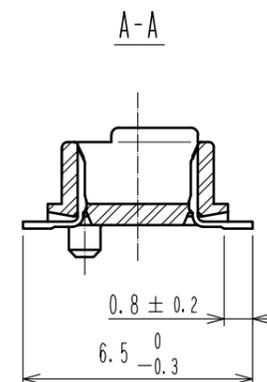


Jan.1.2026 Copyright 2026 HIROSE ELECTRIC CO., LTD. All Rights Reserved.  
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

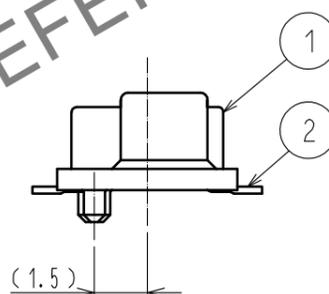

Recommended land pattern dimension of PCB (mounting side) (2:1)

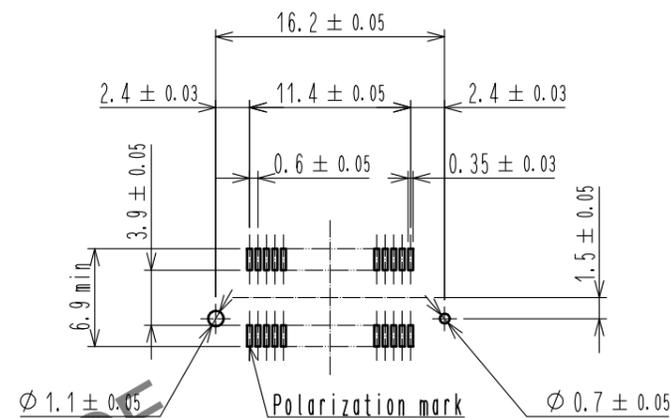

- Notes 1 Lead CO-PLANARITY shall be 0.1mm max.  
2 For modification, etc., preventive hole for sink mark may be added according to circumstances.  
3 The dimensions in parentheses are for reference.

1 PPS		Light brown (UL94V-0)		2 PHOSPHOR BRONZE		Contact area : Gold 0.1µm min.	
NO. MATERIAL		FINISH . REMARKS		NO. MATERIAL		FINISH . REMARKS	
						Lead area : Gold flash	
						Under plating : Nickel 0.5µm min.	
UNITS	⊙	SCALE	COUNT	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
mm		5 : 1	1	DIS-F-00006410	KS. NAKAJIMA	HT. YAMAGUCHI	20200803
APPROVED : HS. OKAWA 20051109				DRAWING NO. EDC-150989-71-25			
CHECKED : HS. OZAWA 20051109				PART NO. FX8-40P-SV(71)			
DESIGNED : TK. YANAGISAWA 20051109				CODE NO. CL578-0009-8-71			
DRAWN : TK. YANAGISAWA 20051109				1/2			


△ Added precaution

Jan.1.2026 Copyright 2026 HIROSE ELECTRIC CO., LTD. All Rights Reserved.  
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


【 Precaution 】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.  
Please divide one side of the board so only one connector is mated per board.

OK

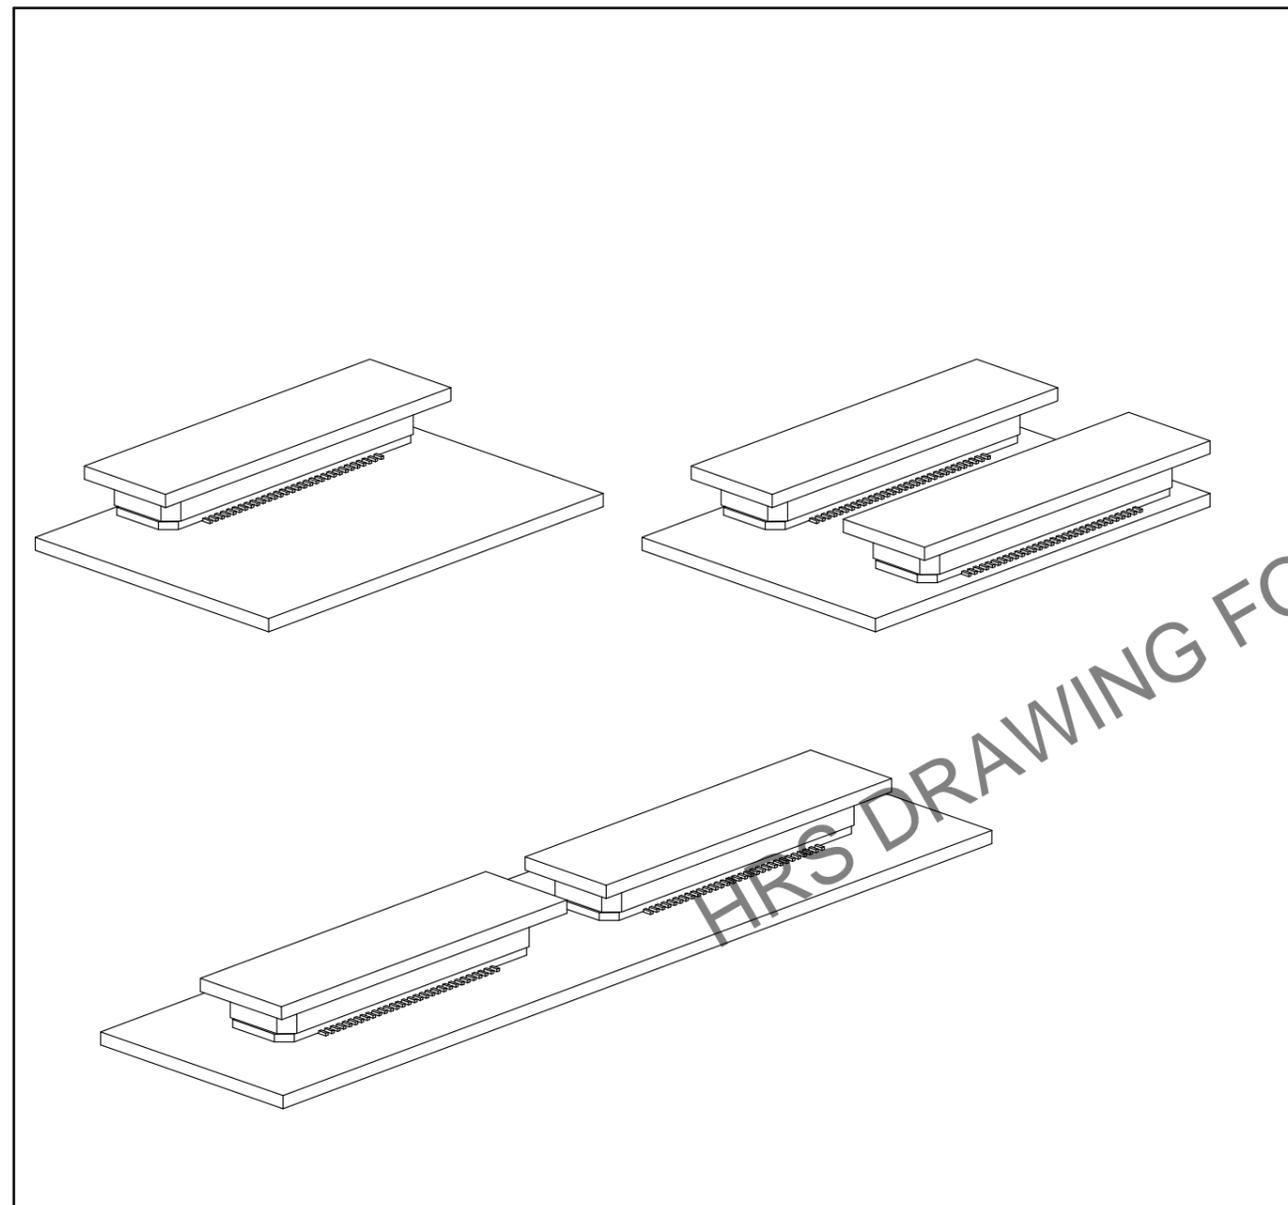

NG

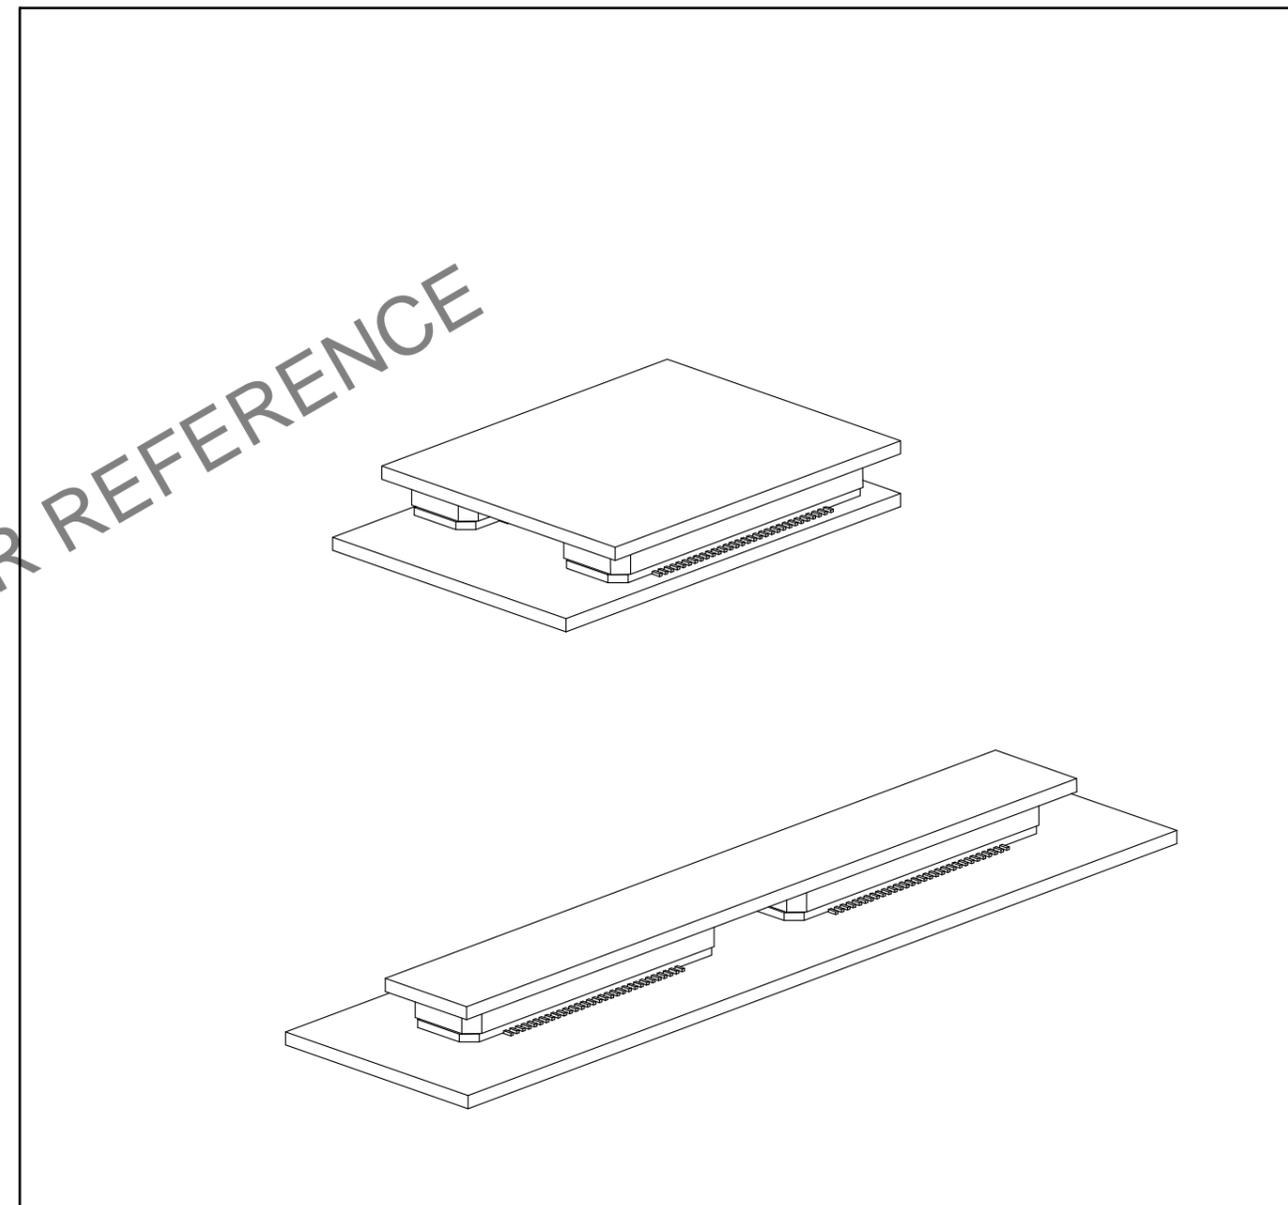

HRS DRAWING FOR REFERENCE

<b>HRS</b>	DRAWING NO.	EDC-150989-71-25
	PART NO.	FX8-40P-SV(71)
	CODE NO.	CL578-0009-8-71
		2/2